

ASTM E 90 SOUND TRANSMISSION LOSS TEST REPORT

Rendered to:

THERMA-TRU DOORS

SERIES/MODEL: Classic-Craft, Fiber Classic, and Smooth Star

TYPE: 3/8 Impact Rated Side Hinged Door

	Summary of Test Results			
ATI Data File No.	Leaf Description	STC	OITC	EWNR
74385.01A*	Fiberglass skins and steel reinforced expanded foam, inoperable test	25	24	29
74385.01B	Fiberglass skins and steel reinforced expanded foam, operable test	25	23	28

^{* -} This test was not performed in accordance with ASTM E90 because the door system was not operable. The door leaf was sealed on both sides with duct tape.

Reference should be made to ATI Report No. 74385.01-113-11 for complete test specimen description. The complete test results are listed in Appendix B.

130 Derry Court York, PA 17406-8405 phone: 717-764-7700 fax: 717-764-4129 www.archtest.com



ACOUSTICAL PERFORMANCE TEST REPORT

Rendered to:

THERMA-TRU DOORS 118 Industrial Drive Edgerton, Ohio 73517

Report No: 74385.01-113-11
Test Date: 10/11/07
Report Date: 12/04/07
Expiration Date: 10/11/11

Test Sample Identification:

Series/Model: Classic-Craft, Fiber Classic, and Smooth Star

Type: 3/8 Impact rated Side Hinged Door

Overall Size: 37-7/8" by 98"

Leaf Size: 36" by 95-1/4"

Leaf Description: Fiberglass Skins and Steel Reinforced Expanded Foam

Project Scope: Architectural Testing, Inc. was contracted by Therma-Tru Doors to conduct sound transmission loss tests on a Series/Model Classic-Craft, Fiber Classic, and Smooth Star, 3/8 impact rated side hinged door. A summary of the results is listed in the Test Results section and the complete test data is included as Appendix B of this report. The sample was provided by the client.

www.archtest.com



Test Methods: The acoustical tests were conducted in accordance with the following:

ASTM E 90-04, Standard Test Method for Laboratory Measurement of Airborne Sound Transmission Loss of Building Partitions.*

ASTM E 413-04, Classification for Rating Sound Insulation.

ASTM E 1332-90 (Re-approved 2003), Standard Classification for Determination of Outdoor-Indoor Transmission Class.

ASTM E 2235-04, Standard Test Method for Determination of Decay Rates for Use in Sound Insulation Test Methods.

* - For test number 74385.01A, the following deviation from the standard was performed: The door was testing in a sealed condition and was not operable during the test. The door leaf was sealed on both sides with duct tape.

Test Equipment: The equipment used to conduct these tests meets the requirements of ASTM E 90. The microphones were calibrated before conducting sound transmission loss tests. The test equipment and test chamber descriptions are listed in Appendix A.

Sample Installation:

Sound transmission loss tests were initially performed on a filler wall that was designed to test 96" by 99" specimens. The filler wall achieved an STC rating of 69.

A filler wall reducing element (STC 69) was used to reduce the test opening size to 38-1/2" wide by 98-1/2" high. The reducing element consisted of a double 2x4 wood stud wall construction with three layers of 5/8" drywall on both sides. The stud cavities in the wall were insulated with two layers of R-13 fiberglass insulation. The door system was placed on a foam isolation pad in the new test opening. Duct seal was used to seal the perimeter of the test specimen to the test opening on both sides. The interior side of the door frame, when installed, was approximately 1/4" from being flush with the receiving room side of the filler wall. A stethoscope was used to check for any abnormal air leaks around the test specimen prior to testing. For the operable test the door panel was opened and closed at least five times prior to testing.



Test Procedure: The door was closed and latched for this test. The sound transmission loss test consisted of the following measurements: One background noise sound pressure level and five sound absorption measurements were conducted at each of the five microphone positions. Two sound pressure level measurements were made simultaneously in both rooms, at each of the five microphone positions. The air temperature and relative humidity conditions were monitored and recorded during the background, absorption, source, and receive room measurements.

Sample Descriptions:

Door Construction:

		Main Frame	Leaf
Siz	e	37-7/8" by 98"	36" by 95-1/4"
Th	ickness	4-1/2"	1-3/4"
Co	rners	Coped	Butted
	Fasteners	Screws	Glue
	Seal Method	Sealant	None
Ma	terial	Wood	See below
	Reinforcement	N/A	Steel / all members
	Thermal Break Material	N/A	N/A
Da	ylight Opening Size	N/A	N/A

Leaf Materials:

Layers (outside to inside)	Layer Description (material and thickness)
1	0.085" Fiberglass skin
2	1.550" Expanded foam
5	0.085" Fiberglass skin

Comments: The lock stile was constructed from 3-7/8" by 1-1/2" plywood. The hinge stile was constructed from 7/8" by 1-1/2" wood. The top and bottom rail contained a composite member measuring 1" by 1-1/2". The door knob and deadbolt holes were reinforced by the lock stile. The hinge stile and lock stile was capped with 5/16" by 1-5/16" wood. The top and bottom rails, and lock stile contained 20 gauge by 3-1/2" steel reinforcement. The hinge stile contained 20 gauge 1-7/8" steel reinforcement.



Sample Descriptions: (Continued)

Components:

	ТҮРЕ	QUANTITY	LOCATION
Wes	atherstrip		
	Foam filled leaf gasket	1 Row	Head and jambs
	Triple leaf flexible door sweep with 1/2" bulb gasket	1	Leaf bottom rail
Har	rdware		
	Full mortise butt hinge	4	Hinge jamb/hinge stile
	Dead bolt assembly	1	Lock stile
	Adjustable threshold	1	Sill
	Door knob	1	Lock stile
	Strike plate	2	Lock jamb
Dra	inage		
	Sloped sill	N/A	N/A

Comments: The weight of the door leaf was 72 lbs. The client did not supply drawings on the Series/Model Classic-Craft, Fiber Classic, and Smooth Star, 3/8 impact rated side hinged door. The door was disassembled, and the components will be retained by ATI for four years. Photographs of the test specimen are included in Appendix C.




Test Results: The STC (Sound Transmission Class) and EWNR (Exterior Wall Noise Reduction) rating was calculated in accordance with ASTM E 413. The OITC (Outdoor-Indoor Transmission Class) was calculated in accordance with ASTM E 1332. A summary of the sound transmission loss test results on the Series/Model Classic-Craft, Fiber Classic, and Smooth Star, 3/8 impact rated side hinged door is listed below.

	Summary of Test Results			
ATI Data File No.	Leaf Description	STC	OITC	EWNR
74385.01A*	Fiberglass skins and steel reinforced expanded foam, inoperable test	25	24	29
74385.01B	Fiberglass skins and steel reinforced expanded foam, operable test	25	23	28

^{* -} This test was not performed in accordance with ASTM E90 because the door system was not operable. The door leaf was sealed on both sides with duct tape.

The complete test results are listed in Appendix B. Flanking limit tests and reference specimen tests are available upon request.





Detailed drawings, data sheets, representative samples of test specimens, a copy of this report, or other pertinent project documentation will be retained by Architectural Testing, Inc. for a period of four years from the original test date. At the end of this retention period, such materials shall be discarded without notice and the service life of this report will expire. Results obtained are tested values and were secured by using the designated test methods. This report does not constitute certification of this product nor an opinion or endorsement by this laboratory. It is the exclusive property of the client so named herein and relates only to the specimen(s) tested. This report may not be reproduced, except in full, without the written approval of Architectural Testing, Inc.

For ARCHITECTURAL TESTING, INC:

Brandon C. Ward
Technician - Acoustical Testing

Todd D. Kister Laboratory Supervisor - Acoustical Testing

BCW:crc

Attachments (pages): This report is complete only when all attachments listed are included.

Appendix-A: Equipment description (1) Appendix-B: Complete test results (6)

Appendix-C: Photographs (1)



74385.01-113-11 Page 7 of 7



Revision Log

<u>Rev. #</u>	Date	Page(s)	Revision(s)
0	12/04/07	N/A	Original Report Issue



Appendix A

Instrumentation:

Instrument	Manufacturer	Model	Description	ATI
				Number
Analyzer	Agilent Technologies	35670A	Dynamic signal analyzer	Y002929
Receive Room Microphone	G.R.A.S.	40AR	1/2", pressure type, condenser microphone	Y003246
Source Room Microphone	G.R.A.S.	40AR	1/2", pressure type, condenser microphone	Y003245
Receive Room Preamp	G.R.A.S.	26AK	1/2" preamplifier	Y003249
Source Room Preamp	G.R.A.S.	26AK	1/2" preamplifier	Y003248
Microphone Calibrator	Bruel & Kjaer	4228	Pistonphone calibrator	Y002816
Noise Source	Delta Electronics	SNG-1	Two, non-coherelated "Pink" noise signals	Y002181
Equalizer	Rane	RPE228	Programmable EQ	Y002180
Power Amplifiers	Renkus-Heinz	P2000	2 - Amplifiers	Y002179 Y001779
Receive Room Loudspeakers	Renkus-Heinz	Trap Jr/9"	2 - Loudspeakers	Y001784 Y001785
Source Room Loudspeakers	Renkus-Heinz	Trap Jr/9"	2 - Loudspeakers	Y002649 Y002650

Test Chamber:

	Volume	Description
Receiving Room	8291.3 ft ³ (234 m ³)	Rotating vane and stationary diffusers. Temperature and humidity controlled. Isolation pads under the floor.
Source Room	7296.3 ft ³ (206.6 m ³)	Stationary diffusers only. Temperature and humidity controlled.

	Maximum Size	Description
TI Test Opening	14 ft wide by 10 ft high	Vibration break between source and receive
The Test Opening	14 it wide by 10 it high	rooms.



Appendix B

Complete Test Results



SOUND TRANSMISSION LOSS and EXTERIOR WALL NOISE REDUCTION

Architectural Testing

ASTM E90

ATI No. 74385.01A **Date** 10/11/07

Client Therma-Tru Doors

Specimen Classic-Craft, Fiber-Classic and Smooth Star, side hinged, impact rated door, Inoperable

test

Specimen Area23.81 Sq FtFiller Area116.19 Sq FtOperatorBrandon C. Ward

	Bkgrd	Absorp	Source	Receive	Filler	Specimen
Temp F	73.7	75.1	76.0	73.9	74.9	74.7
RH %	44.9	43.2	44.1	44.5	59.1	44.2

	Bkgrd	Absorp	Source	Receive	Filler	Specimen	95%	No. of	Trans
Freq	SPL	(Sabines	SPL	SPL	TL	TL	Conf	Defici-	Coef
(Hz)	(dB)	/Sq Ft)	(dB)	(dB)	(dB)	(dB)	Limit	encies	Diff
80	39.2	51.8	86.8	67.3	39.0	16	2.75	0	16.0
100	40.4	53.1	88.6	69.2	42.8	16	3.11	0	20.0
125	41.2	48.7	94.5	68.2	53.4	23	3.30	0	23.4
160	42.9	51.3	95.5	71.9	52.7	20	1.49	0	25.5
200	42.8	52.0	100.6	76.1	54.2	21	0.85	0	26.2
250	39.8	54.5	101.0	75.3	55.9	22	0.77	0	26.9
315	36.9	56.0	99.6	70.6	57.3	25	1.06	0	25.1
400	34.5	63.1	99.1	69.1	63.3	26	0.69	0	30.6
500	32.8	60.8	100.7	69.1	66.3	28	0.76	0	31.9
630	27.6	58.3	103.6	71.1	69.0	29	0.30	0	33.5
800	27.7	63.1	103.5	71.1	72.9	28	0.47	0	37.9
1000	27.2	67.3	102.8	74.0	76.7	24	0.40	4	45.5
1250	26.8	72.3	106.0	79.8	78.4	21	0.38	8	50.1
1600	22.6	77.3	112.4	84.9	77.2	22	0.26	7	48.0
2000	16.4	80.3	108.1	75.9	75.7	27	0.29	2	41.9
2500	12.3	91.3	106.8	66.4	77.7	35	0.27	0	36.3
3150	10.4	110.5	107.8	62.5	87.1	39	0.38	0	41.7
4000	9.5	130.7	106.3	55.3	90.7	44	0.47	0	40.2
5000	8.3	174.6	104.7	48.7	90.8	47	0.27	0	36.7

STC Rating = 25 (Sound Transmission Class)

Deficiencies =21(Number of deficiencies versus contour curve)OITC Rating =24(Outdoor/Indoor Transmission Class)

EWNR Rating= 29 (Exterior Wall Noise Reduction)

Note: The acoustical chambers are qualified for measurements down to 80 hertz.

Data reported below 80 hertz is for reference only.




ATI No. 74385.01A **Date** 10/11/07

Client Therma-Tru Doors

Specimen Classic-Craft, Fiber-Classic and Smooth Star, side hinged, impact rated door,

Inoperable test

Specimen Area 23.81 Sq Ft Filler Area 116.19 Sq Ft Operator Brandon C. Ward

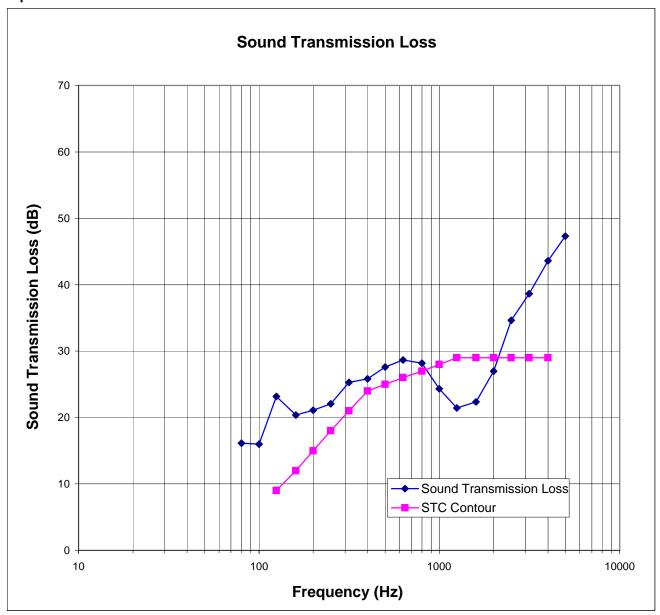




ATI No. 74385.01A **Date** 10/11/07

Client Therma-Tru Doors

Specimen Classic-Craft, Fiber-Classic and Smooth Star, side hinged, impact rated door, Inoperable

test

Specimen Area23.81 Sq FtFiller Area116.19 Sq FtOperatorBrandon C. Ward

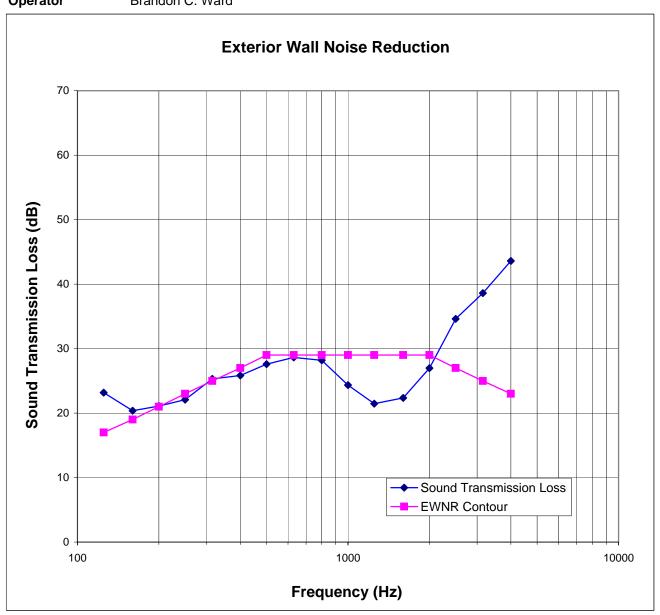



SOUND TRANSMISSION LOSS and EXTERIOR WALL NOISE REDUCTION

Architectural Testing

ASTM E90

ATI No. 74385.01B **Date** 10/11/07

Client Therma-Tru Doors

Specimen Classic-Craft, Fiber-Classic and Smooth Star, side hinged, impact rated door, operable test

Specimen Area23.81 Sq FtFiller Area116.19 Sq FtOperatorBrandon C. Ward

	Bkgrd	Absorp	Source	Receive	Filler	Specimen
Temp F	75.6	75.9	77.1	75.7	74.9	76.1
RH %	42.4	42.0	42.0	42.2	59.1	42.1

	Bkgrd	Absorp	Source	Receive	Filler	Specimen	95%	No. of	Trans
Freq	SPL	(Sabines	SPL	SPL	TL	TL	Conf	Defici-	Coef
(Hz)	(dB)	/Sq Ft)	(dB)	(dB)	(dB)	(dB)	Limit	encies	Diff
80	43.1	51.5	86.8	67.5	39.0	16	2.18	0	16.2
100	39.3	54.8	88.7	69.3	42.8	16	2.82	0	20.1
125	40.0	52.3	94.7	68.8	53.4	23	3.70	0	24.1
160	43.3	49.1	95.5	73.0	52.7	19	1.34	0	26.5
200	42.9	54.9	100.5	77.1	54.2	20	0.73	0	27.5
250	39.0	53.2	101.1	76.6	55.9	21	0.69	0	28.0
315	36.5	60.4	99.7	71.4	57.3	24	1.16	0	26.1
400	35.8	62.7	99.1	70.0	63.3	25	0.86	0	31.6
500	34.0	63.0	100.9	70.4	66.3	26	0.82	0	33.2
630	28.4	62.1	103.6	72.5	69.0	27	0.26	0	35.1
800	29.3	63.3	103.5	73.7	72.9	26	0.43	1	40.5
1000	28.0	67.6	102.8	75.5	76.7	23	0.36	5	47.0
1250	27.4	72.7	106.0	80.1	78.4	21	0.29	8	50.5
1600	23.5	75.9	112.3	85.3	77.2	22	0.23	7	48.4
2000	15.9	81.4	108.1	76.7	75.7	26	0.23	3	42.7
2500	7.5	91.0	106.8	69.4	77.7	32	0.17	0	39.3
3150	8.2	107.2	107.7	66.2	87.1	35	0.38	0	45.3
4000	7.4	131.8	106.3	62.8	90.7	36	0.33	0	47.8
5000	7.6	174.6	104.6	59.2	90.8	37	0.25	0	47.2

STC Rating = 25 (Sound Transmission Class)

Deficiencies = 24 (Number of deficiencies versus contour curve)

OITC Rating = 23 (Outdoor/Indoor Transmission Class)

EWNR Rating= 28 (Exterior Wall Noise Reduction)

Note: The acoustical chambers are qualified for measurements down to 80 hertz.

Data reported below 80 hertz is for reference only.






ATI No. 74385.01B **Date** 10/11/07

Client Therma-Tru Doors

Specimen Classic-Craft, Fiber-Classic and Smooth Star, side hinged, impact rated door, operable

test

Specimen Area 23.81 Sq Ft Filler Area 116.19 Sq Ft Operator Brandon C. Ward

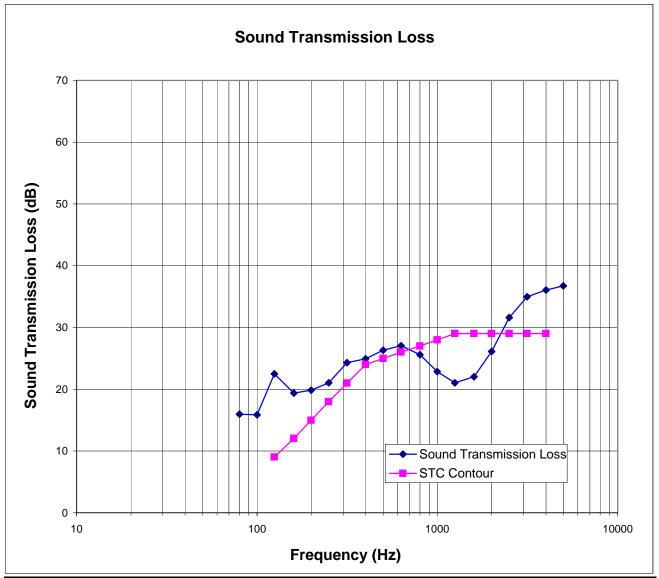






ATI No. 74385.01B **Date** 10/11/07

Client Therma-Tru Doors

Specimen Classic-Craft, Fiber-Classic and Smooth Star, side hinged, impact rated door, operable

test

Specimen Area23.81 Sq FtFiller Area116.19 Sq FtOperatorBrandon C. Ward

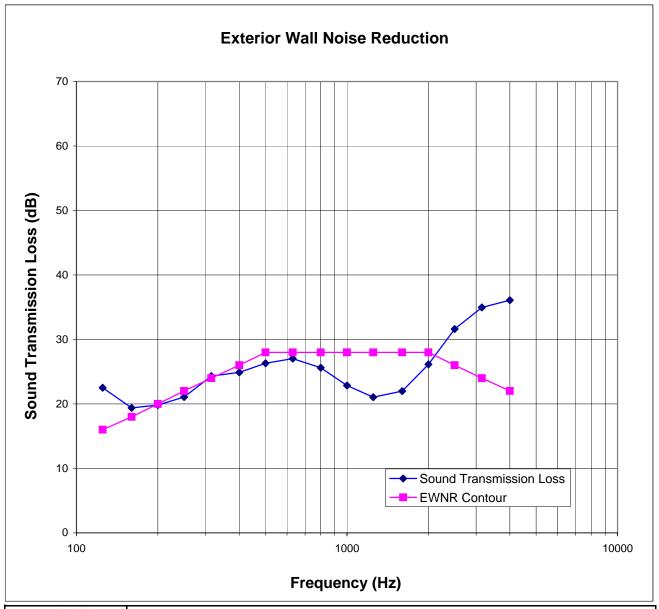





Appendix C Photographs



Leaf Cross Section at Bottom Rail